
	INSPECTION REPORT	Report Date:	Jun. 5 2008	Overall Result PASS
		Booking No.:		
		Inspection No.:		6 Pages
		Client Name:		

		Defect	Actual found	Allowed limit
		Critical	0	0
Factory Name:	N/A	Major	3	10
		Minor	11	14
Inspection Date:	Begin: date-June.5 2008 time- 10:00	End: date- June.5 2008 time- 15:20		

Product Description: Handy Man Cap										
P.O.No.	Item/Style/Sku	Ordered Quantity		Supplied Quantity		Packed Quantity		Unpacked Quantity		Barcode
		Units	Ctns	Unit	Ctns	Units	Ctns	Units	Ctns	
2043-04	DMLHAT	5000	40	5000	40	5000	40	0	0	N/A
2055-05	DMLHAT	5000	40	5000	40	5000	40	0	0	N/A
Total:	N/A	10000	80	10000	80	10000	80	0	0	N/A

INSPECTION RESULT SUMMARY						
	PASS	FAIL	PENDING	N/A	REMARK	
PRODUCT TYPE	X					
WORKMANSHIP	X					
ON-SITE TESTS	X					
PACKING&ASSORTMENT	X					
LABELING,PRINGTING&MARKING	X					


A.GENERAL	
From: Wenzhou Trust Testing & Inspection Co., Ltd.(TTC) Contact: Vicky Lin Tel: 0086-577-88915592 Fax: 0086-577-88915610 Email:ttctest@gmail.com Inspector Name(s):NICK	
Service Performed: FRI	Ref. Sample Received Date: Apr. 20 2008
Total qty of Export Ctns:80Ctns	Number of Export Cartons Opened for Inspection: 9Ctns
List of Export Carton Numbers Opened:	20,40,39,29,7,35,25,13,2

	INSPECTION REPORT	Report Date:	Jun. 5 2008	Overall Result PASS
		Booking No.:	N/A	
		Inspection No.:		
		Client Name:		6 Pages

B.REMARKS	
1.	Approval sample was provided for this inspection.
2.	Actual found 125pcs per carton.

C. INSPECTION CRITERIA				
Inspection Standard:		ANSI/ASQC Z1.4(formerly known as MIL-STD-105)		
Inspection Level-Workmanship/Visual:	G II	AQL-Critical Defectives:	0	
		AQL-Major Defectives:	2.5	
Sample Size-Workmanship/Visual:	200PCS	AQL-Minor Defectives:	4.0	
		AQL-Other:	N/A	
Description		Critical	Major	Minor
1.	Missing sewing label		1	
2.	Only five stitches line on tongue		1	
3.	Uneven stitches		1	
4.	Uncut thread end			7
5.	Stain mark			2
6.	Mess stitches			2
Total Found:		0	3	11
Total Allowed:		0	10	14
Result:		PASS	PASS	PASS

D. ON-SITE TESTS				
	Check Points		Findings	Result
1.	Description:	Product size	58cm ,58cm,58cm Same as approval sample	PASS
	Sample Size:	3pcs		
2.	Description:	Carton drop test	No failure	PASS
	Sample Size:	1ctn		

	INSPECTION REPORT	Report Date:	Jun. 5 2008	Overall Result PASS
		Booking No.:	N/A	
		Inspection No.:		6 Pages
		Client Name:		

E. PACKING & ASSORTMENT								
Packing								
Cartons	Quantity	Carton Size (cm)					Weight (Kgs)	Result
		Length	Width	Height	Other	Client Tolerance		
Export/Outer (given)	120	60	43	43	N/A	N/A	14	N/A
Export/Outer (actual)	125	48	38.5	33	N/A		9.5	
Assortment								
No. of Cartons Checked		No. of Cartons Failed		Findings / Comments			Result	
1		0		NO FAILURE			PASS	
Export Carton Details								
New or Used	New		Sealing		Opaque Gummed Tape		No	
Material	Paper card				Transparent Gummed Type		yes	
# Corrugated Paper Plies	5 plies				Paper Type		No	
Fastening- Metal Staples	No		Strapping		Nylon Band		No	
Individual package: 1 pc product packed into a ploy-bag.								
Result: PASS								

F. LABELING / PRINTING / MARKING			
Name	Location	Findings / Comments	Result
Sewing label	Inside cap	NO FAILURE	PASS
Result: PASS			

For the details, please see the following attached photos.







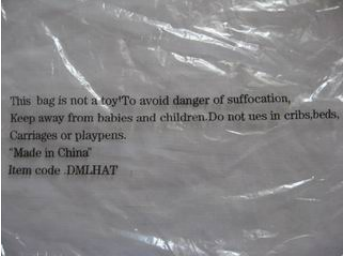
	INSPECTION REPORT	Report Date: Jun. 5 2008	Overall Result PASS
		Booking No.:	
		Inspection No.:	6 Pages
		Client Name:	

Photo 1	Photo 2	Photo 3
		
Approval sample	Approval sample	Approval sample
Photo 4	Photo 5	Photo 6
		
carton	Shipping mark	Side mark
Photo 7	Photo 8	Photo 9
		
packing	Poly-bag packing	Warning words on poly-bag


	INSPECTION REPORT	Report Date:	Jun. 5 2008	Overall Result PASS
		Booking No.:		
		Inspection No.:		6 Pages
		Client Name:		

Photo 10	Photo 11	Photo 12
		
product	product	Sewing label
Photo 13	Photo 14	Photo 15
		
missing sewing label	Only five stitches line on tongue	Uneven stitches
Photo 16	Photo 17	Photo 18
		
uncut thread end	uncut thread end	uncut thread end
Photo 19	Photo 20	Photo 21
		
uncut thread end	Stain mark	Stain mark



	INSPECTION REPORT	Report Date:	Jun. 5 2008	Overall Result
		Booking No.:		PASS
		Inspection No.:		
		Client Name:		6 Pages

Photo 22	Photo 23	Photo 24
	N/A	N/A
Mess stitches	N/A	N/A

Approval by:	VICKY LIN
Date:	Jun. 5 2008