
	INSPECTION REPORT	Report Date:	Mar 26. 2008	Overall Result PASS
		Booking No.:		
		Inspection No.:		6 pages
		Client Name:		

Vendor/Supplier:		Defect	Actual found	Allowed limit
		Critical	0	0
Factory Name:		Major	0	5
		Minor	5	7
Inspection Date:	Begin: date- Mar 26 .2008 Time-10:00	End: date- Mar 26. 2008	Time-16:00	

	Product Description: copper color bag									
P.O.No.	Item/Style/Sku	Ordered Quantity		Supplied Quantity		Packed Quantity		Unpacked Quantity		Barcode
		Units	Ctns	Units	Ctns	Units	Ctns	Units	Ctns	
2004-01	ILK225	525	27	525	27	525	27	0	0	N/A
Total:	N/A	525	27	525	27	525	27	0	0	N/A

INSPECTION RESULT SUMMARY					
	PASS	FAIL	PENDING	N/A	REMARK
PRODUCT TYPE	X				
WORKMANSHIP	X				
ON-SITE TESTS	X				
PACKING&ASSORTMENT	X				
LABELING,PRINGTING&MARKING	X				


A.GENERAL	
From: Wenzhou Trust Testing & Inspection Co., Ltd.(TTC) Contact: Vicky Lin Tel: 0086-577-88915592 Fax: 0086-577-88915610 Email:ttctest@gmail.com Inspector Name(s): Benjamin Zhang	
Service Performed: FRI	Ref. Sample Received Date: Mar 17 th , 2008
Total qty of Export Ctns:27CTNS	Number of Export Cartons Opened for Inspection:6CTNS
List of Export Carton Numbers Opened:	NO CARTON NUMBER

	INSPECTION REPORT	Report Date:	Mar 26. 2008	Overall Result
		Booking No.:		PASS
		Inspection No.:		
		Client Name:		6 pages

B.REMARKS	
1.	Approval sample was provided for this inspection.
2.	A shipment sample was kept by TTC.

C. INSPECTION CRITERIA					
Inspection Standard:		ANSI/ASQC Z1.4(formerly known as MIL-STD-105)			
Inspection Level-Workmanship/Visual:		G II	AQL-Critical Defectives:	0	
			AQL-Major Defectives:	2.5	
Sample Size-Workmanship/Visual:		80pcs	AQL-Minor Defectives:	4.0	
			AQL-Other:	N/A	
Description			Critical	Major	Minor
1.	Glue mark on handle				2
2.	Untrimmed thread end				1
3.	Mess stitches on handle				1
4.	Scratch mark on D-ring				1
Total Found:			0	0	5
Total Allowed:			0	5	7
Result:			PASS	PASS	PASS

D. ON-SITE TESTS				
	Check Points		Findings	Result
1.	Description:	Product size	45*28*14cm	PASS
	Sample Size:	3Pcs	45*28*14cm	
2.	Description:	Carton drop test	NO FAILURE	PASS
	Sample Size:	1 Carton		

	INSPECTION REPORT	Report Date:	Mar 26. 2008	Overall Result
		Booking No.:		PASS
		Inspection No.:		
		Client Name:		6 pages

E. PACKING & ASSORTMENT								
Packing								
Cartons	Quantity	Carton Size (cm)					Weight (Kgs)	Result
		Length	Width	Height	Other	Client Tolerance		
Export/Outer (given)	20	43	40	44	N/A	N/A	12	N/A
Export/Outer (actual)	20	43	40.5	44	N/A		12.4	
Assortment								
No. of Cartons Checked		No. of Cartons Failed		Findings / Comments			Result	
1		0		NO FAILURE			Pass	
Export Carton Details								
New or Used	NEW		Sealing	Opaque Gummed Tape		NO		
Material	PAPER CARD			Transparent Gummed Type		YES		
# Corrugated Paper Plies	5 PLIES			Paper Type		NO		
Fastening- Metal Staples	NO		Strapping	Nylon Band		NO		
Individual package: One piece packed into a re-mailer bag.								
Result: PASS								

F. LABELING / PRINTING / MARKING			
Name	Location	Findings / Comments	Result
Sewing label	Inside bag	No failure	PASS
Result: PASS			

For the details, please see the following attached photos.



	INSPECTION REPORT	Report Date:	Mar 26. 2008	Overall Result
		Booking No.:		PASS
		Inspection No.:		
		Client Name:		6 pages

Photo 1	Photo 2	Photo 3
		
Approval sample	Label	Approval
Photo 4	Photo 5	Photo 6
		
Carton	Shipping mark	Side mark
Photo 7	Photo 8	Photo 9
		
Packed into carton	Re-mailer	Item No.


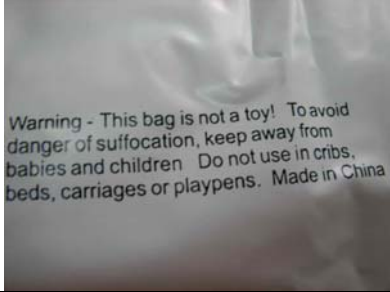








	INSPECTION REPORT	Report Date:	Mar 26, 2008	Overall Result
		Booking No.:	N/A	PASS
		Inspection No.:	2004-01	
		Client Name:	Overseas Advantage Inc.	6 pages

Photo 10	Photo 11	Photo 12
		
Warning words	Product	Product
Photo 13	Photo 14	Photo 15
		
Product	Silica gel	Sewing label
Photo 16	Photo 17	Photo 18
		
Sewing label	Glue mark on handle	Glue mark on handle


	INSPECTION REPORT	Report Date:	Mar 26. 2008	Overall Result
		Booking No.:		PASS
		Inspection No.:		
		Client Name:		6 pages

Photo 19	Photo 20	Photo 21
		
Untrimmed thread end	Mess stitches	Scratch mark on metal D-ring

Approval by:	Vicky Lin
Date:	Mar 27. 2008